


FIG.1

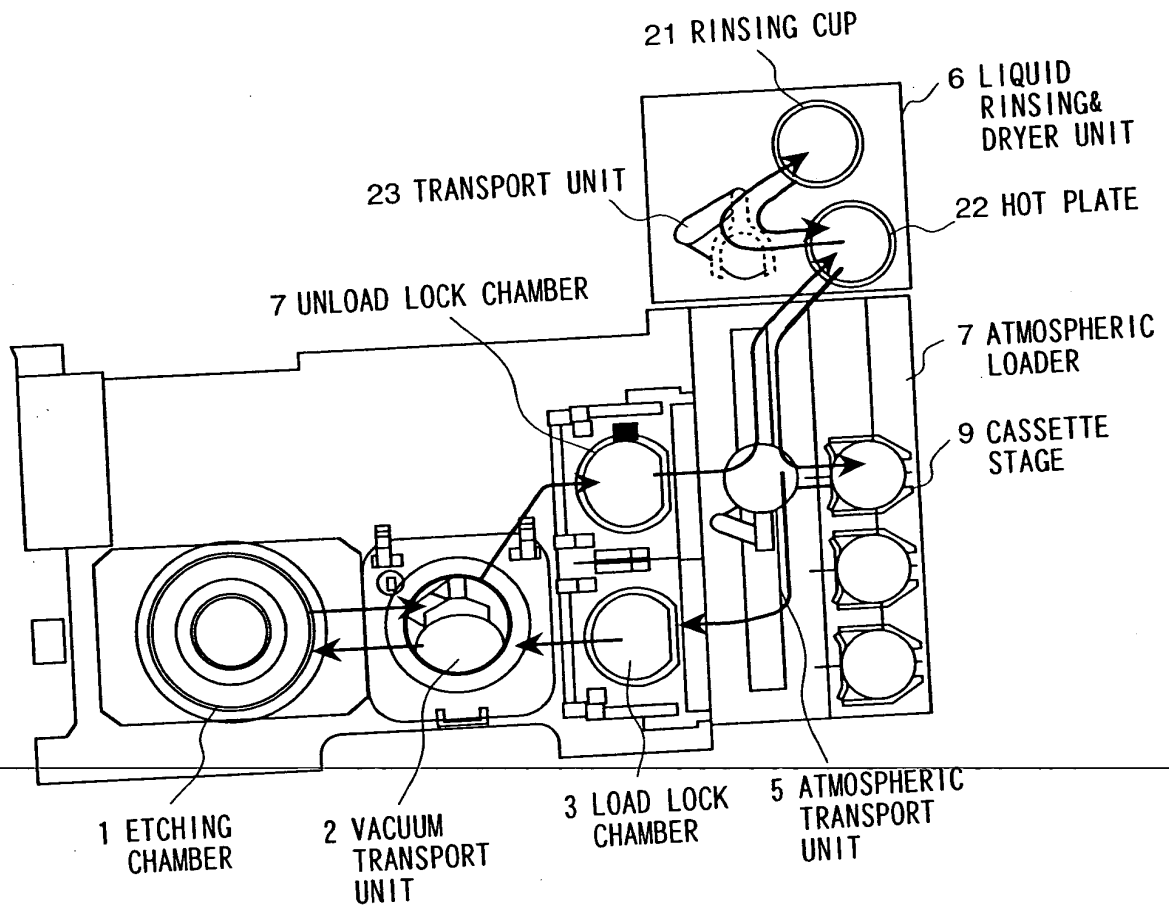

10083353.022702

FIG.2

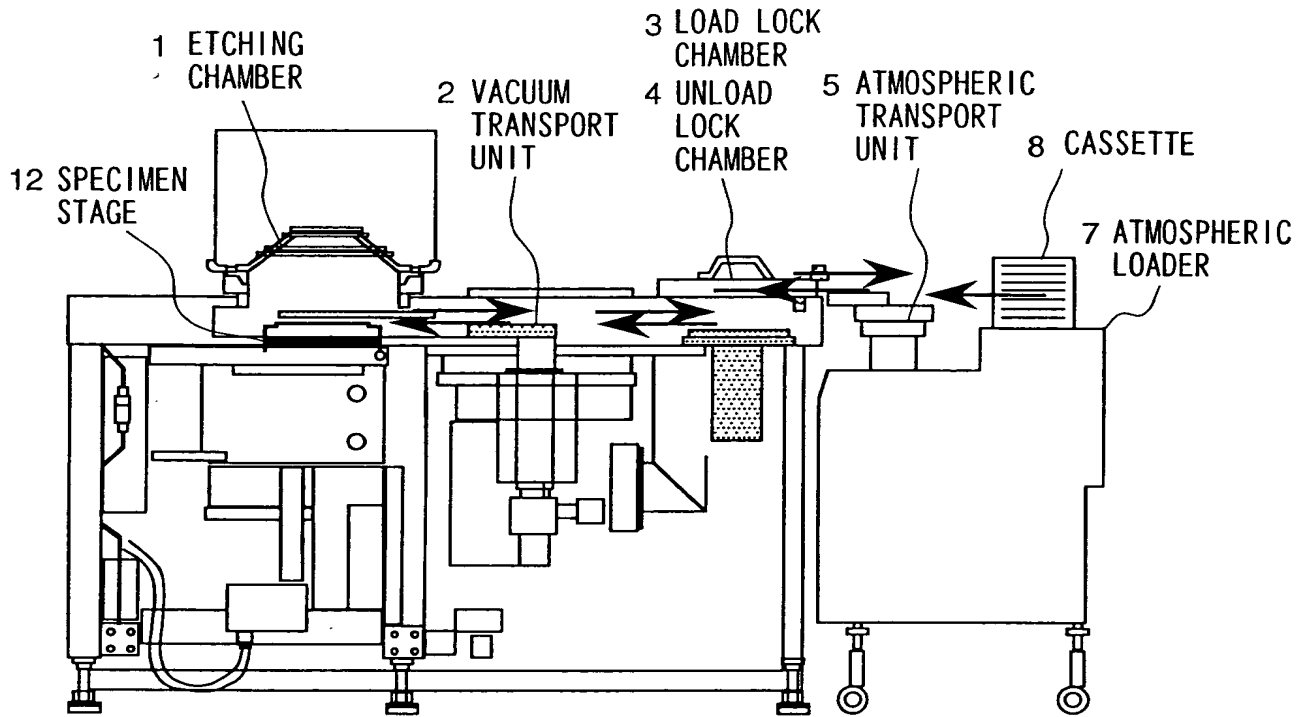


FIG.3

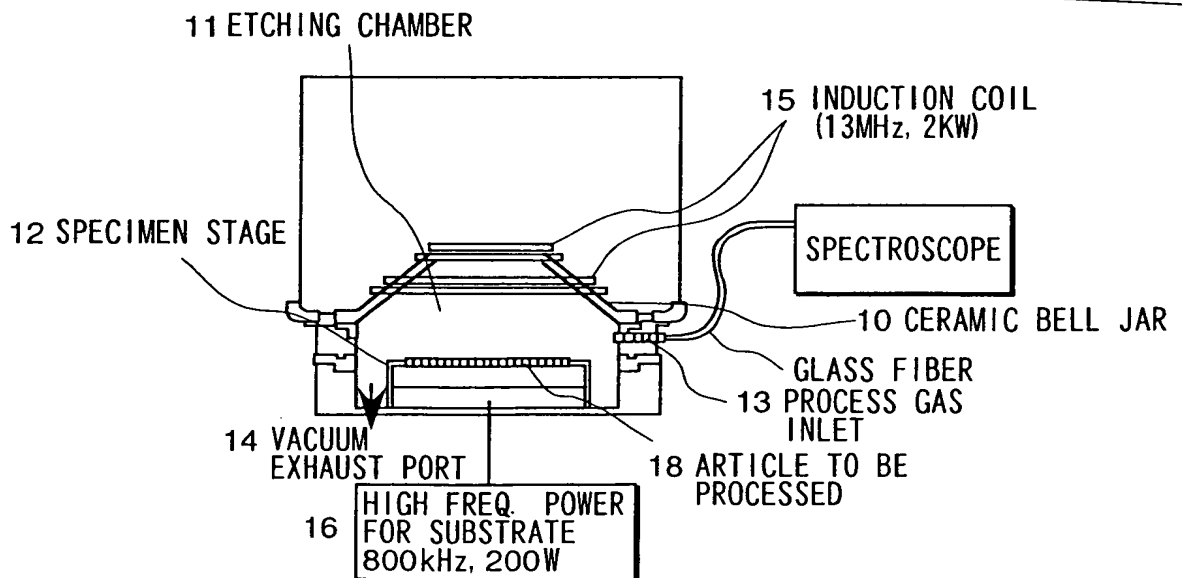


FIG.4



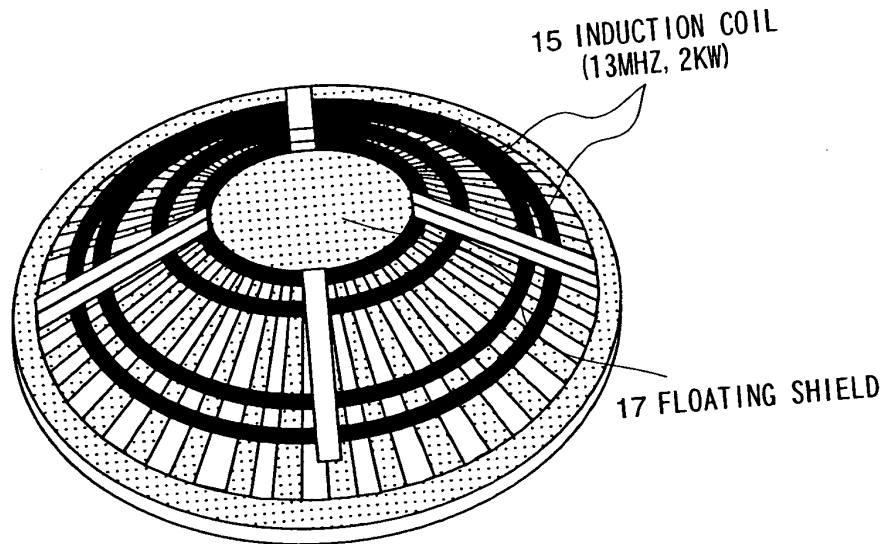


FIG.5

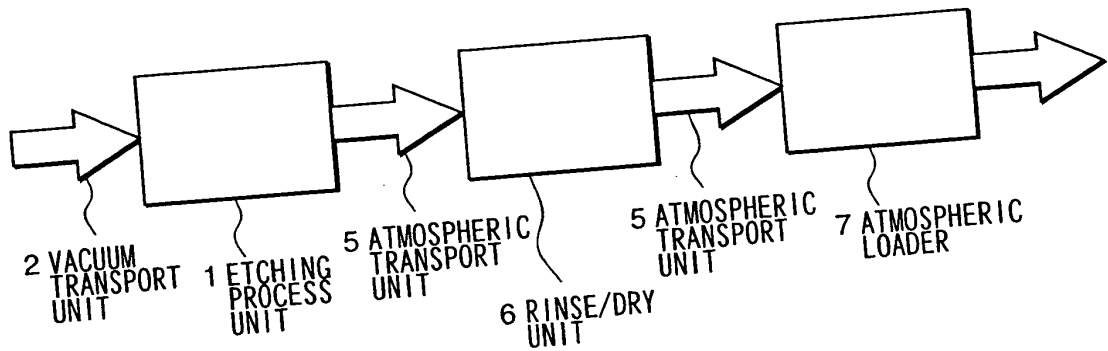

10083353.022702

FIG.6

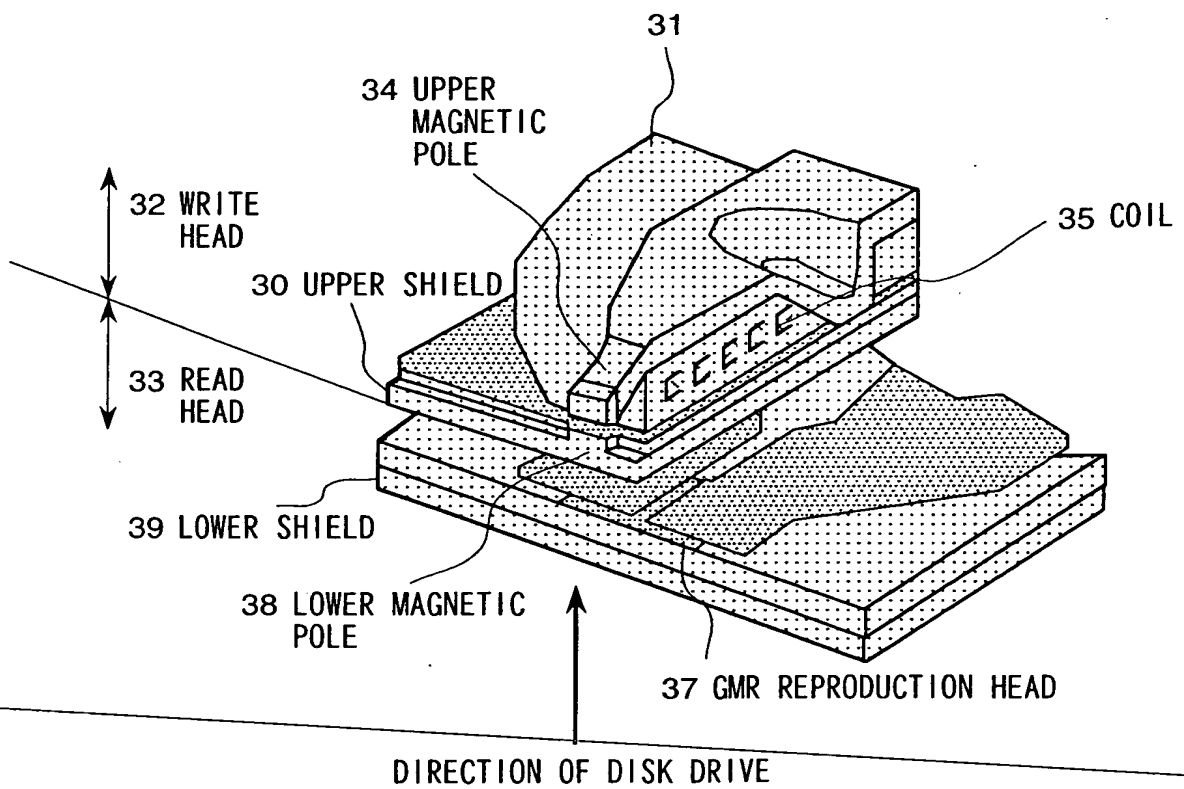

10083353.022702

FIG.7

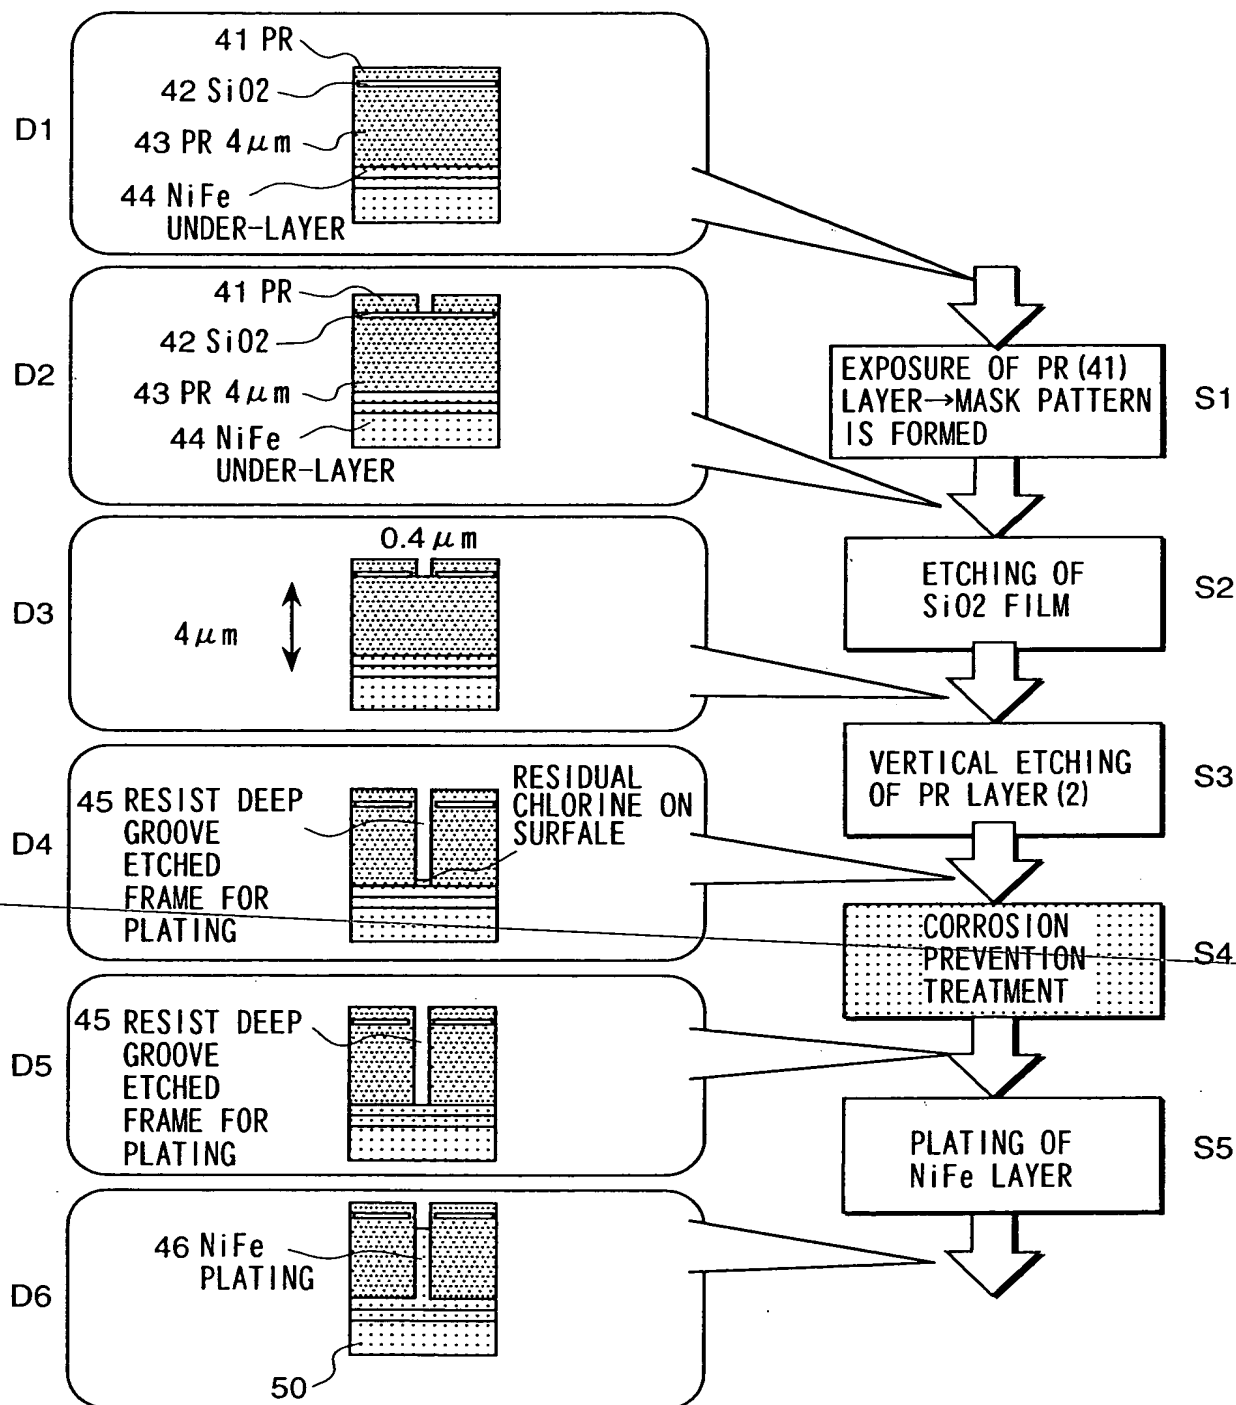


FIG.8

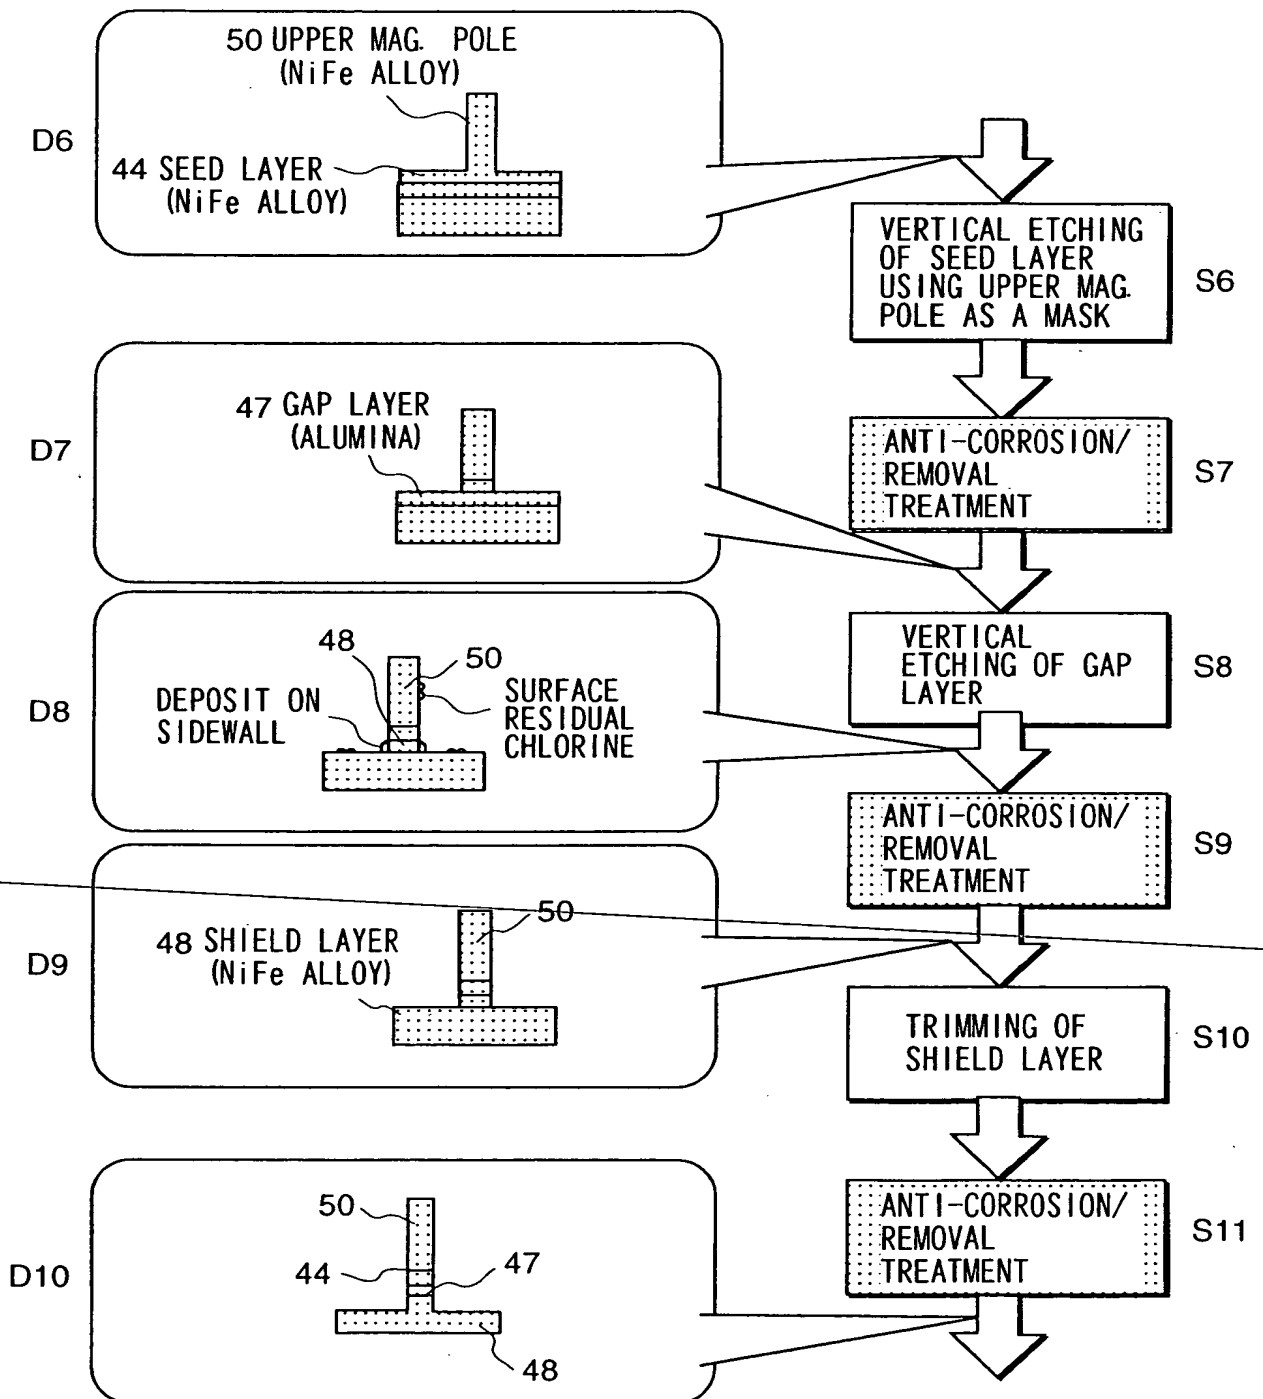


FIG. 9

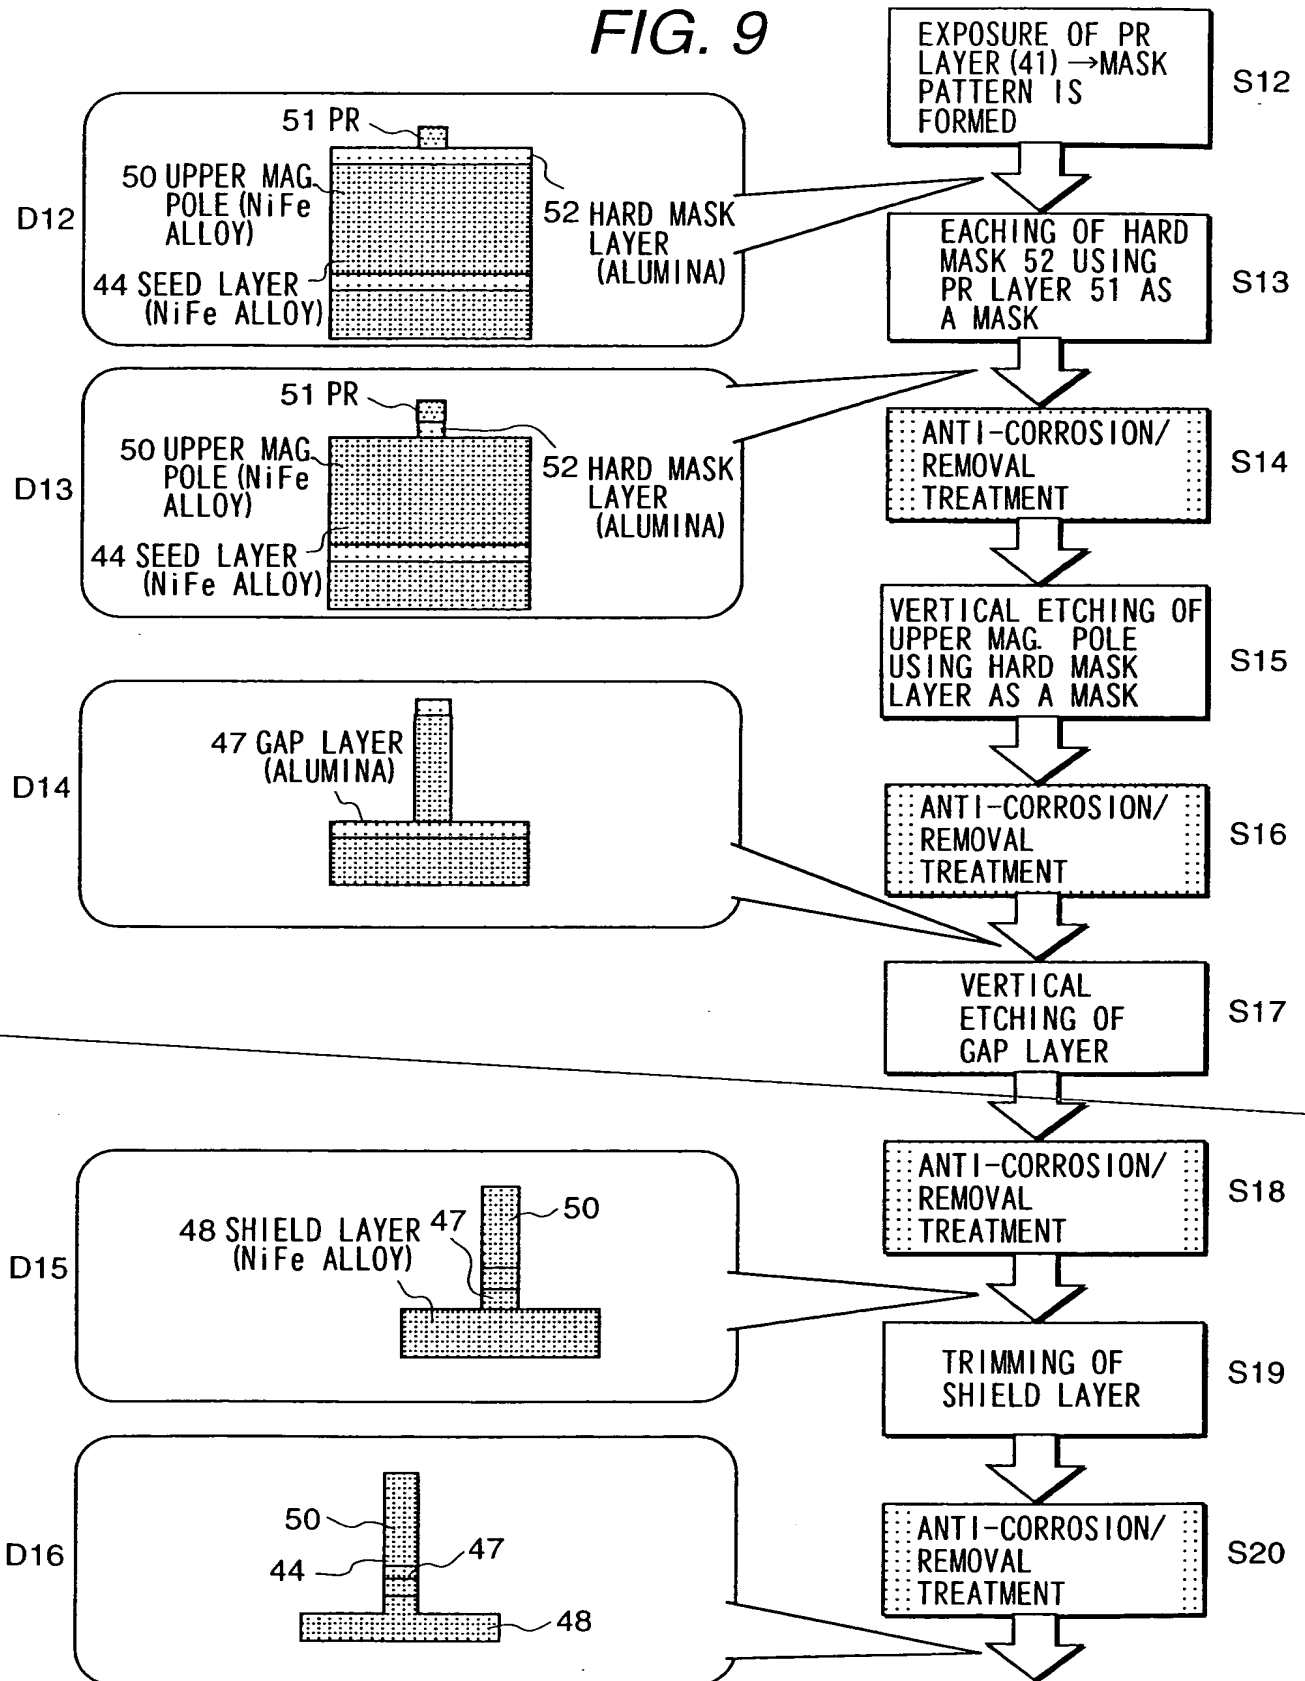


FIG.10

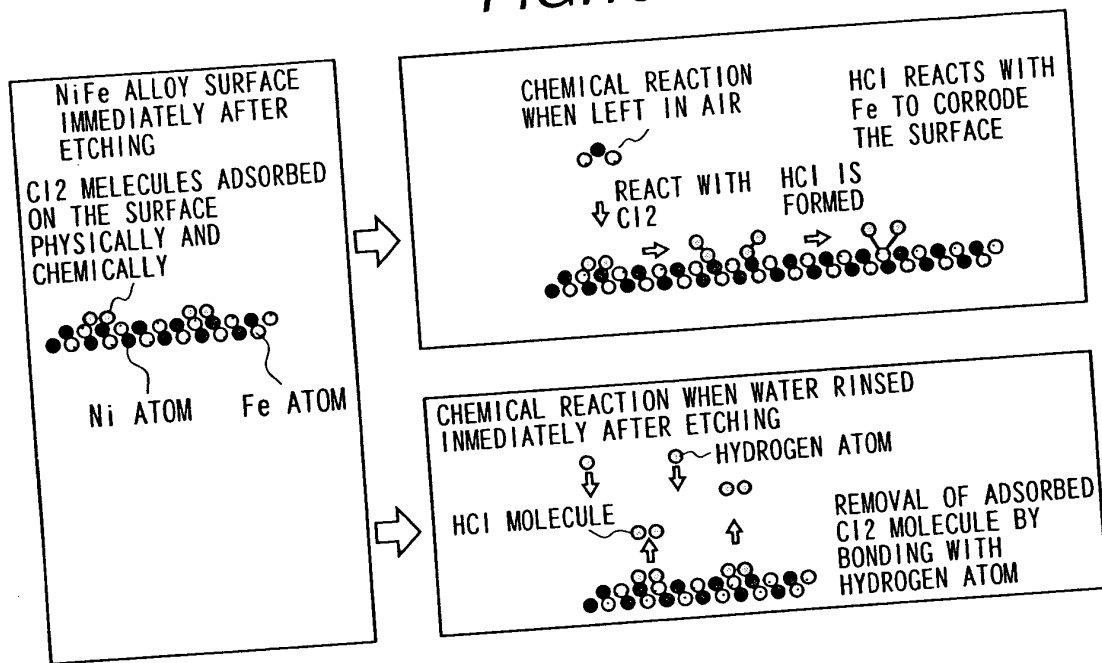
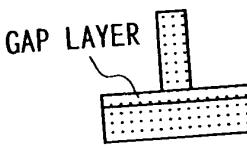
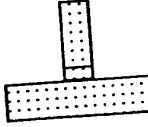
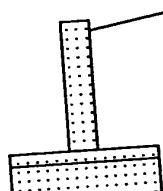
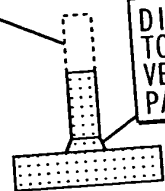


FIG.12

	BEFOR ETCHING	AFTER ETCHING
PLASMA ETCHING		
MILLING	 <p>A LONGER INITIAL LENGTH OF UPPER MAGNETIC POLE NECESSIATED DUE TO LOW SELECTIVITY RATIO → DIFFICULT TO OBTAIN PRECISE SIZE CONTROL</p>	 <p>DIFFICULT TO OBTAIN VERTICAL PATTERN</p>

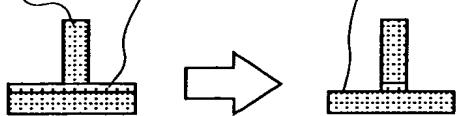
10083353.022702

FIG.11

EXPERIMENTAL CONDITIONS*	TIME UNTIL CORROSION OCCURS
LEFT IN AIR AFTER ETCHING OF GAP LAYER	5 MIN.
LEFT IN AIR AFTER PURE WATER RINSING/DRYING WITHIN 2 MIN. AFTER ETCHING OF GAP LAYER	AFTER MORE THAN 2 WEEKS

ITEM	UNIT	RESULT
RATE	nm/min	108.5

## \*OTHER CONDITIONS

ITEM	CONDITIONS
DEVICE STRUCTURES PRIOR TO & AFTER ETCHING	 <p>UPPER MAG. POLE (NiFe ALLOY)    GAP LAYER (ALUMINA)    SHIELD LAYER (NiFe ALLOY)</p>
GAS	Cl 20sccm+BCl3 30sccm
PRESSURE	0.3Pa
STAGE TEMP.	40°C
SOURCE RF POWER	750W
SOURCE RF FREQ.	13.56MHz
BIAS RF POWER	60W
BIAS RF FREQ.	800KHz

10083353.022702